

DALI IO-4 & IO-6

FIRMWARE UPDATE


Requirements for use of DALI IO firmware update tool:

- A PC with Windows 7 or later
Note that MAC is not supported



Important:
Pause any active virus scanner during update.

Virus scanners may delete necessary files.

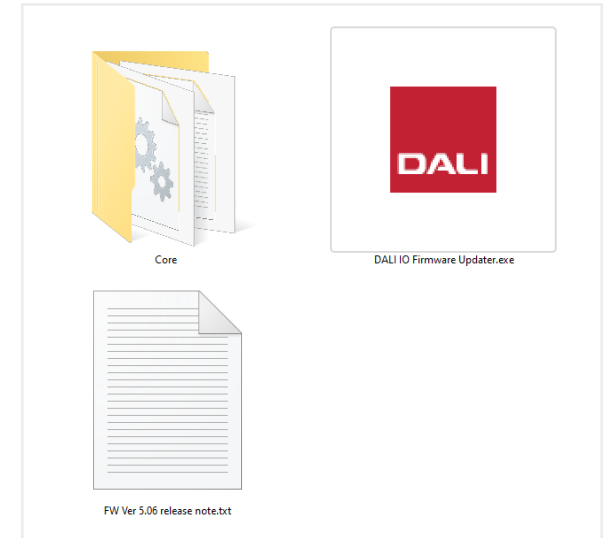

Download files from this link:

<https://www.dali-speakers.com/media/6969/fw-ver-506.zip>

Unzip the file.



FIRMWARE UPDATING STEPS




Connect the headphone to the computer using the USB cable.



Turn **ON** the headphones.

If needed, wait for Windows to install necessary drivers before starting the update.

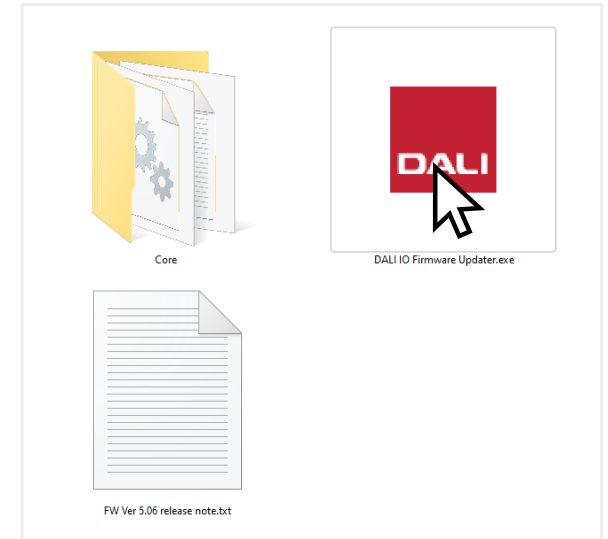

Double-click the file **DALI IO Firmware Updater**.

If prompted by a warning, allow the program to continue.



FIRMWARE UPDATING STEPS



Choose correct headphone model.


Click **START UPDATE**. Wait for the program to finalize.

Make sure not to turn off or unplug the headphones during update.

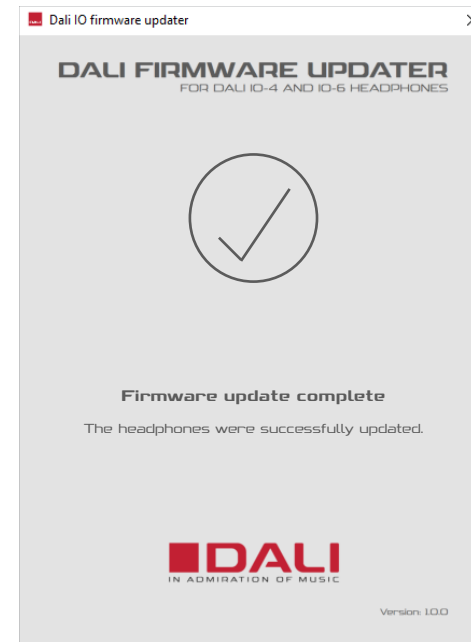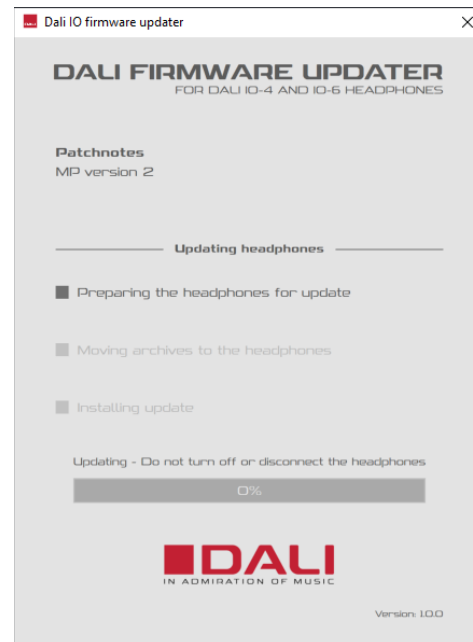

Close the program and disconnect the headphones from the computer.

After update a new Bluetooth pairing is required.

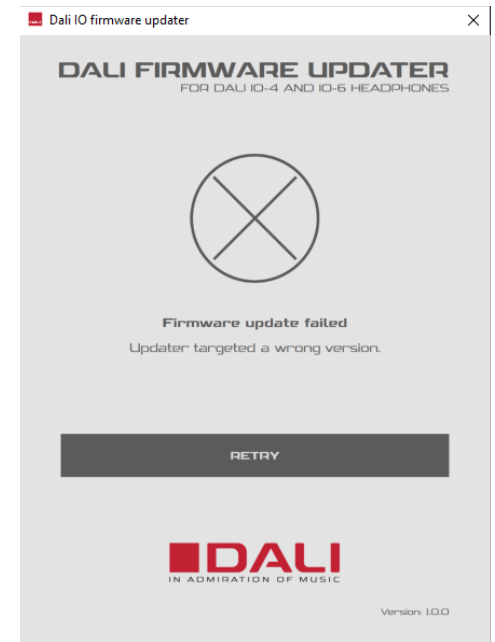

In case the incorrect model is chosen, an error indication will show up after update.

Perform the update again with the correct model chosen.

